



PRIMO DANMARK A/S
Jernbanegade 11
DK-6862 Tistrup
Tlf. +45 76 98 33 14
www.primolister.dk
stdsalg@primo.dk



MONTERINGSVEJLEDNING ASSEMBLY INSTRUCTIONS

FiberCore Glaslister FiberCore Glazing Beads



INFORMATION: Glaslisterne leveres i hvid, men kan males i ønsket farve. Det frarådes at male i stærke eller mørke farver, da listen kan krympe op til 1% grundet temperatursvingninger.

Til FiberCore glaslisterne i længden 1,5 m. medfølger der 8 clips og 8 skruer. Glaslisterne fås også i længder a 2,5 og 4 m. Hertil købes clips og skruer separat.

EN: The glazing beads are supplied in white, but can be painted in the desired colour. It is not recommended to paint in strong or dark colours as the moulding can shrink up to 1% due to temperature fluctuations.

For FiberCore glazing beads in length 1.5 m, 8 clips and 8 screws are included. The glazing beads are also available in lengths of 2.5 and 4 metres, for which clips and screws are purchased separately.

Bund / Base

1



DK: Fjern forsigtigt eksisterende bundglasliste og rengør falsen.

PRIMO anbefaler at falsen males inden monteringen af de nye PRIMO glaslister.

EN: Carefully remove existing base glazing bead and clean the rebate.

PRIMO recommends that the rebate is painted before installing the new PRIMO glazing beads.

2




Stram falsmål / Tight rebate measure

DK: Til beregning af den vandrette bundglasliste måles der efter stram falsmål. Se ovenfor

EN: To calculate the horizontal bottom glazing bead, measure after tight rebate measurement. See above

3

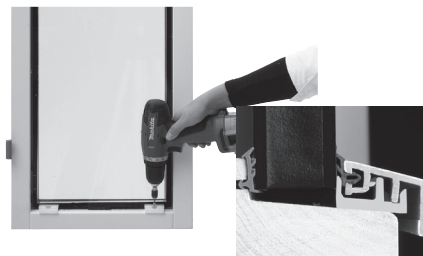

DK: Clipsene sættes ind mod glasset. Fastgøres i det forborede hul med skruer, der skrues skråt i.

Der skal bruges 5 clips pr. meter.

Afstand fra hjørne skal være max 5 cm.

Clipsene er til skrå bundfals, der svare til en hældning på 7 grader

EN: The clips must be inserted up against the glass. Fixed in the pre-drilled hole with screws screwed in at an angle.

You need 5 clips per metre.

Distance from the corner must be max 5 cm.

The clips are for bevelled bottom rebate, which corresponds to an inclination of 7 degrees

4



DK: Pres nu med let tryk FiberCore bundglaslisten ind mod monteringsclipsen indtil klik-funktionen er opnået.

Glasbåndet kan fugtes med sæbevand for at lette monteringen.

EN: Now gently press the FiberCore base glazing bead against the mounting clip until the click function is achieved.

The glazing bead can be moistened with soapy water to facilitate installation.

Side-Top


1



DK: Fjern forsigtigt en liste ad gangen og monter clipsen, så ruden ikke falder ud. Der skrues skråt i. Clipsene skal sættes ind mod glasset. Fastgøres i det forborede hul med skruer, der skrues skråt i.

EN: Carefully remove one panel at a time and attach the clips so that the glass does not fall out. The screws are screwed in at an angle. The clips must be inserted up against the glass. Fasten with screws that are screwed in at an angle.

2

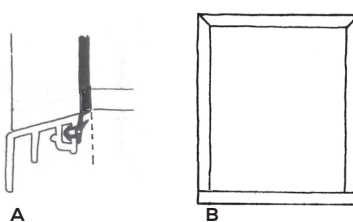

DK: Sideglaslister kan enten afsluttes mod en gennemgående topglasliste med 16 graders smig i begge ender (A), eller der kan afsluttes i toppen med et smig på 45 grader og et smig i bunden på 16 grader (B).

Da FiberCore ikke suger vand, kan sideglaslisten afsluttes ned til bundglaslisten.

EN: Side glazing beads can either be terminated against a continuous top glazing bead with a 16 degree slope at both ends (A), or can be terminated at the top with a 45 degree slope and a 16 degree slope at the bottom (B).

Since FiberCore does not absorb water, the side glazing bead can be terminated down to the base glazing bead.

3



DK: Clips skal være monteret på side- og topglaslisten ved savning for at opnå korrekt gering

Der skal bruges 5 clips pr. meter.

Afstand fra hjørne skal være max 5 cm.

Efter afkortning lægges listerne til kontrol i falsen uden at klikke listerne fast i clipsene. Af sikkerhedsmæssige årsager er listerne svære at afmontere, når de er sat i.

EN: Mounting brackets must be fitted to the side and top glazing bead when sawing to achieve the correct slight

Use 5 clips per metre.

Distance from the corner must be max 5 cm.

After shortening, the profiles are placed in the rebate for checking without clicking the beads into the clips. For safety reasons, the profiles are difficult to remove once they are in place.

4



DK: Pres nu glaslisten ind mod monteringsclipsen indtil klikfunktionen er opnået.

Glasbåndet kan fugtes med sæbevand for at lette monteringen.

EN: Now press the glazing bead against the mounting clip until the click function is achieved.

The glazing bead can be moistened with soapy water to facilitate installation.